

LANSSGH830R8

Installation Instructions

Lankota GENERATION II Stalk Stomper® Kit for Geringhoff Corn Heads

8 - Row Coverage

LANKOTA®

270 West Park Avenue

Huron, SD 57350

866-966-5682

Numerical Parts List

Part Numbers	Description	Quantity
LANSSB96BLK	96" Stalk Stomper® Tool Bar	2
LANSSGHT2	Gerringhoff Tool Bar mount	4
LANSSGHP1	Gerringhoff Clamp Plate	8
LANSS659	Rear Mount Flip Up	6
LANSS650QD	Rear Mount Flip Up	2
LANSSGH	Box Containing Bags of Hardware	1
LANSS668BH	Bag of Hardware	6
LAN600UBOLT	U-bolt 5/8" x 2.265" ID x 3.75" Length	2
LAN690830	5/8"-11 Serrated Flange Nut	4
LANFNXC1	1/2"-13 Flanged Nyloc Nut	1
LANFNHVK	1/2"-13 x 2.5" Flanged Cap Screw	1
LANSSGH830R8BH	Bag of Hardware	1
LAN600UBOLT	U-bolt 5/8" x 2.265" ID x 3.75" Length	8
LAN690830	5/8" Serrated Flange Nut	32
LAN26E32	5/8"-11 x 5.50" Hex Head Cap Screw	16

Pictorial Parts List

				
LANSSB96BLK(2)	LANSSGHT2 (4)	LANSSGHP1 (8)	LANSS659 (6)	LANSS650QD (2)
				
LAN600UBOLT (16)	LAN690830 (56)	LANFNHVK (6)	LANFNXC1 (6)	LAN26E32 (16)

Preparation

1. Attach desired header to the combine. Lock the head to the combine.
2. Raise the head off the ground and lower the safety stop on the feeder house cylinder.
3. Set the parking brake on the combine.
4. Turn off the combine engine and remove the key.

Installation

Refer to Figures 1 & 2

1. Place the clamp plates (LANSSGHP1) on top of the header frame tube located under the back of the head and bolt the tool bar mount (LANSSGHT2) to the tube. They can be placed halfway between rows as shown in Figure 2, but make sure to leave room for the deck plate parts to move properly. Do the same on the opposite side of the head.

Hardware:

LAN26E32 5/8"-11 x 5.50" Hex Head Cap Screw

LAN690830 5/8" Serrated Flange Nut

Figure 1



Figure 2



Installation

Refer to Figures 3 & 4

2. Install the tool bars (LANSSB96BLK) using the provided U-bolts and flange nuts. Repeat on the opposite side of the head as well.

Hardware:

LAN600UBOLT

U-Bolt 5/8" x 2.625" ID x 3.75" L

LAN690830

5/8" Serrated Flange Nut

Figure 3



Figure 4



Installation

Refer to Figures 5 & 6

3. Install the LANSS659 mounts in line with every row except the two middle rows. Install the LANSS650QD mounts in line with the two rows in the middle.

Hardware:

LAN600UBOLT	U-Bolt 5/8" x 2.625" ID x 3.75" L
LAN690830	5/8" Serrated Flange Nut

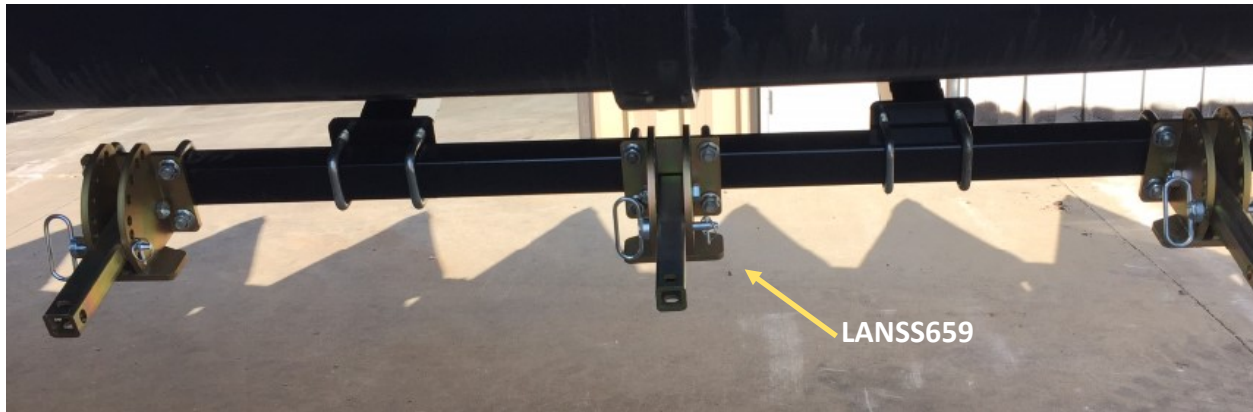


Figure 5

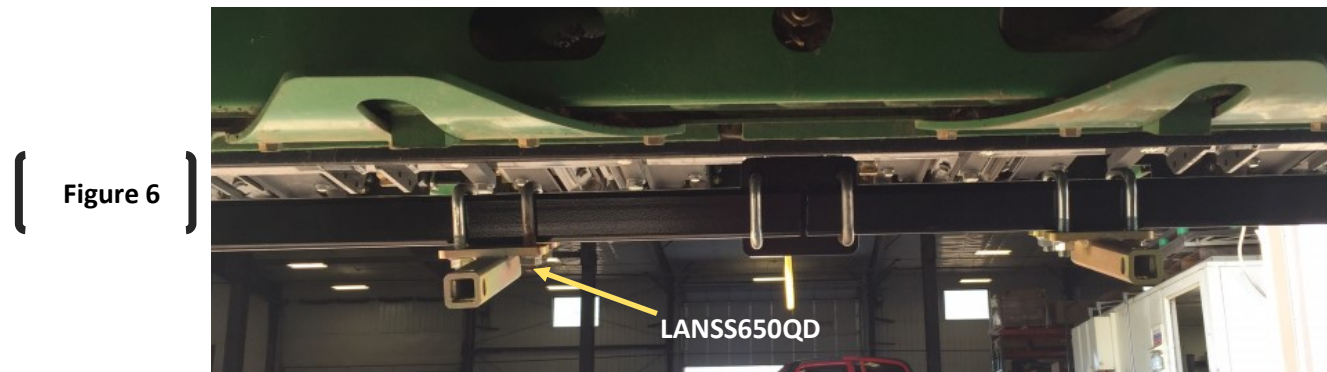


Figure 6

Installation

Refer to Figure 8

4. Tighten all hardware if not already done so.
5. Slide shoes onto the mounts. Secure center 2 rows with 4" pin (LANSS604) and all the others with 1/2" x 2.5" Flange bolt (LANFNHVK) and 1/2" Flange Nyloc nut (LANFNXC1).


Figure 7



Stalk Stomper Disclaimer

Stalk Stomper Disclaimer

The most effective use of the Lankota Stalk Stomper® is achieved by adjusting the stomper pad so that when the corn head is at its normal cutting height, the pad of the shoe is 1" above the ground. Over compression of the spring can shorten the life of the stomper spring, increase wear on the poly liner, and may result in undue damage NOT covered by Lankota's Limited Warranty.

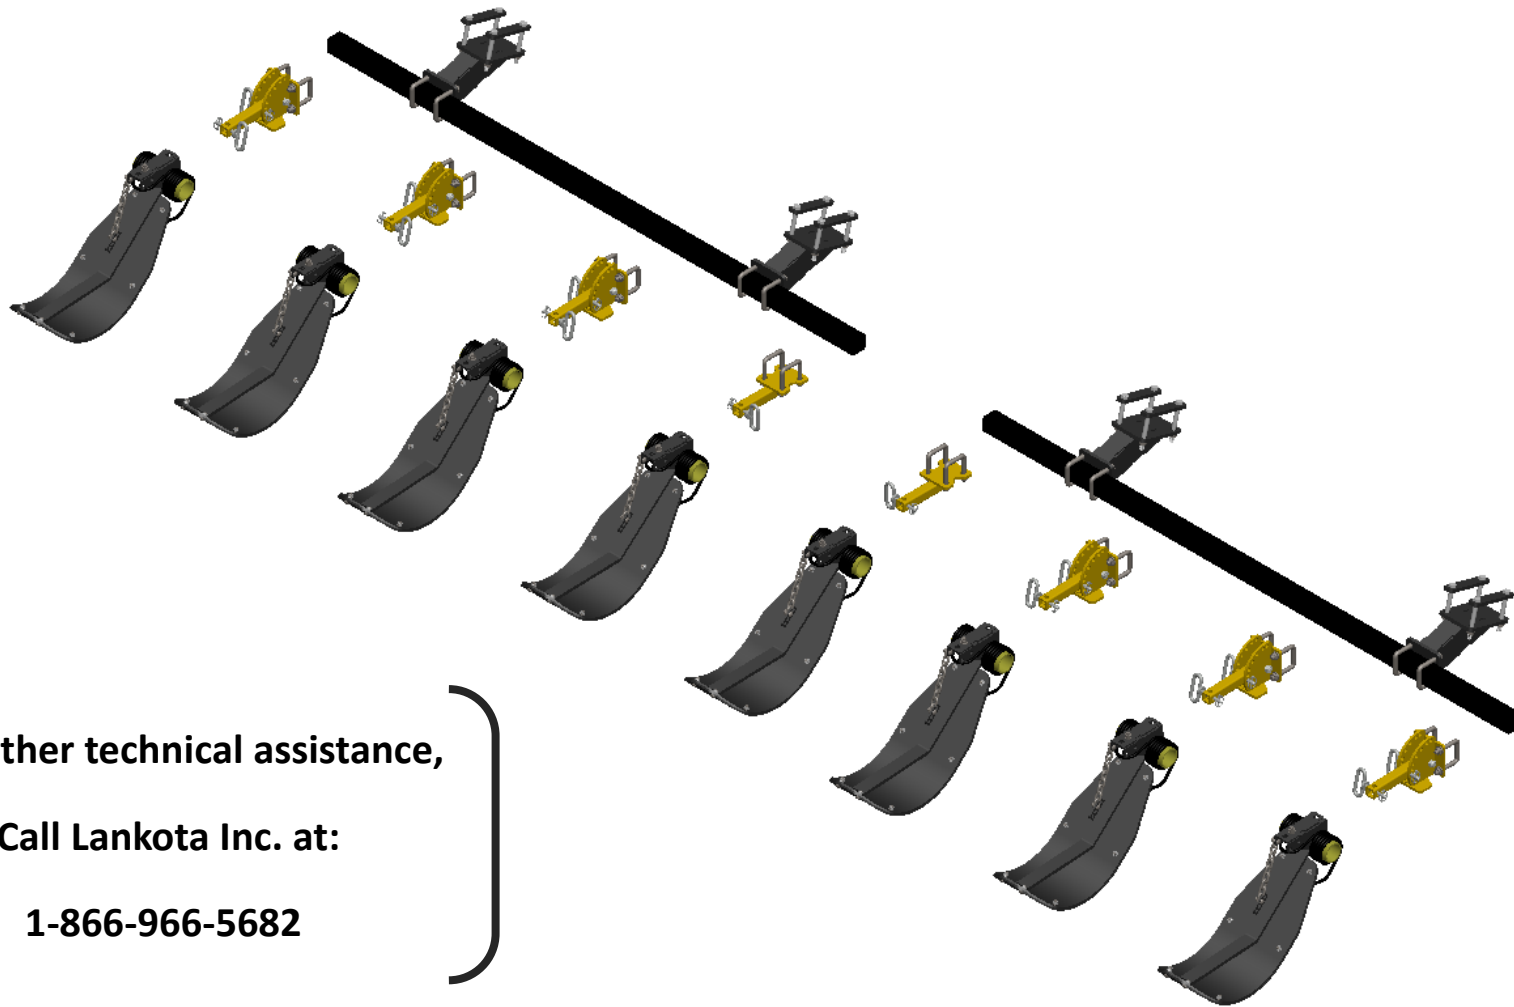

For further technical assistance,

Call Lankota Inc. at:

1-866-966-5682